



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	346	Date:	10/25/2004	MeterBasin:	01_WR29
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	10	Setup No:	6	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
7010		Boxford	ROAD

Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	2=Trace
Sector:	2=Private	Drainage Area:	0		

Comments:

SMOKE TEST PHOTOS

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.




SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland


FIELD SKETCH

Page 1 of 2
Smoke Set No. 25
Setup No. 6
346

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-25-04	Start Time: 1635
Crew: T3	Street Location: BOXFORD RD + OLYMPIA AVE		
US MH: 1520834	DS MH: 1522046	Number of Segments: 8	Test Length: 1341
Plugged US: <input checked="" type="checkbox"/> Y <input type="checkbox"/> N	Plugged DS: <input checked="" type="checkbox"/> Y <input type="checkbox"/> N	# of Blowers: 1 (2) 3	Ground: <input checked="" type="checkbox"/> Dry <input type="checkbox"/> Moderate <input type="checkbox"/> Wet
Plugs Removed? <input checked="" type="checkbox"/> Y <input type="checkbox"/> N	Recorder: SAM	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

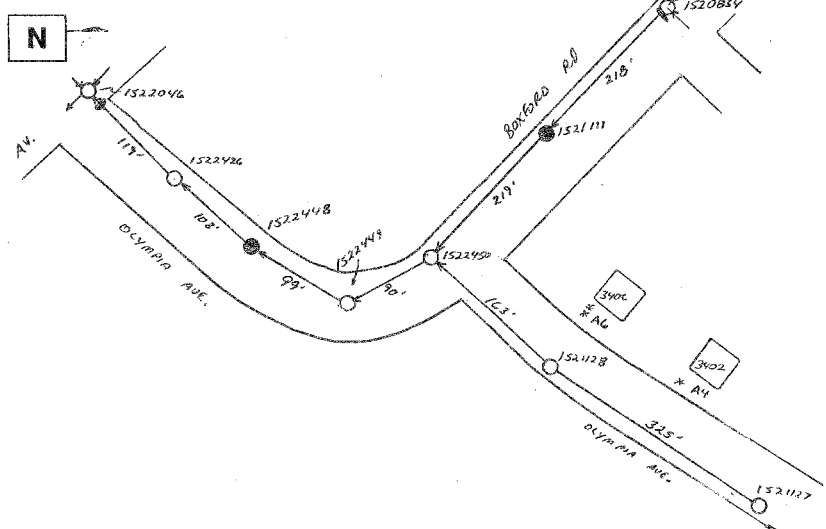

CREW COMMENTS

Last Revised 9/16/2004Leader Form

Sketch No:

346

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\346.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	346	Date:	10/25/2004	MeterBasin:	01_WR29
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	11	Setup No:	6	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
7009		Boxford	ROAD

Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	3=Moderate
Sector:	2=Private	Drainage Area:	0		

Comments:

SMOKE TEST PHOTOS

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 25
Setup No. 6
346

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-25-04	Start Time: 1635
Crew: T3	Street Location: BOXFORD RD + OLYMPIA AVE		
US MH: 1520834	DS MH: 1522046	Number of Segments: 8	Test Length: 1341
Plugged US: <input checked="" type="checkbox"/> Y <input type="checkbox"/> N	Plugged DS: <input checked="" type="checkbox"/> Y <input type="checkbox"/> N	# of Blowers: 1 (2) 3	Ground: <input checked="" type="checkbox"/> Dry <input type="checkbox"/> Moderate <input type="checkbox"/> Wet
Plugs Removed? <input checked="" type="checkbox"/> Y <input type="checkbox"/> N	Recorder: SAM	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

Last Revised 9/16/2004 Leader Form

Sketch No: 346

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\346.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	346	Date:	10/25/2004	MeterBasin:	01_WR29
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	12	Setup No:	6	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
7001		Boxford	ROAD

Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	2=Trace
Sector:	2=Private	Drainage Area:	0		

Comments:

SMOKE TEST PHOTOS

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.




SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland


FIELD SKETCH

Page 1 of 2
Smoke Set No. 25
Setup No. 6
346

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-25-04	Start Time: 1635
Crew: T3	Street Location: BOXFORD RD + OLYMPIA AVE		
US MH: 1520834	DS MH: 1522046	Number of Segments: 8	Test Length: 1341
Plugged US: <input checked="" type="checkbox"/> Y <input type="checkbox"/> N	Plugged DS: <input checked="" type="checkbox"/> Y <input type="checkbox"/> N	# of Blowers: 1 (2) 3	Ground: <input checked="" type="checkbox"/> Dry <input type="checkbox"/> Moderate <input type="checkbox"/> Wet
Plugs Removed? <input checked="" type="checkbox"/> Y <input type="checkbox"/> N	Recorder: SAM	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

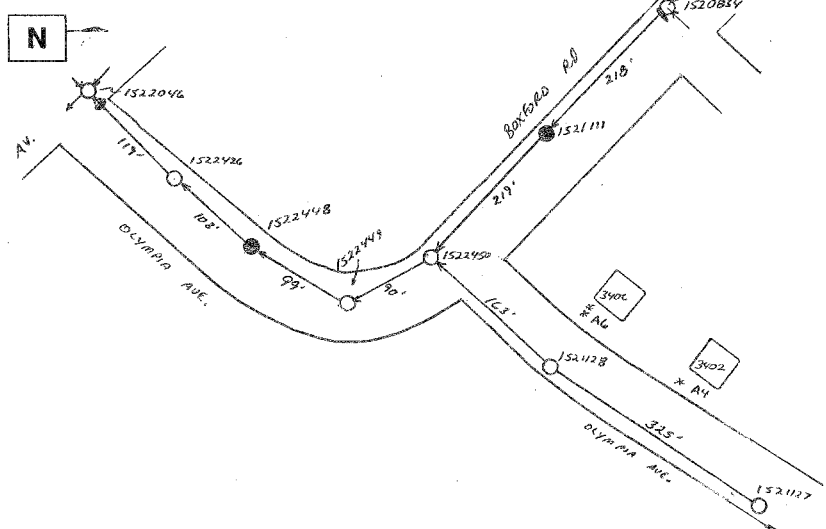

CREW COMMENTS

Last Revised 9/16/2004Leader Form

Sketch No: 346

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\346.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	346	Date:	10/25/2004	MeterBasin:	01_WR29
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	13	Setup No:	6	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
3410		Olympia	AVE

Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	2=Trace
Sector:	2=Private	Drainage Area:	0		

Comments:

SMOKE TEST PHOTOS

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.




SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland


FIELD SKETCH

Page 1 of 2
Smoke Set No. 25
Setup No. 6
346

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-25-04	Start Time: 1635
Crew: T3	Street Location: BOXFORD RD + OLYMPIA AVE		
US MH: 1520834	DS MH: 1522046	Number of Segments: 8	Test Length: 1341
Plugged US: <input checked="" type="radio"/> Y <input type="radio"/> N	Plugged DS: <input checked="" type="radio"/> Y <input type="radio"/> N	# of Blowers: 1 (2) 3	Ground: <input checked="" type="radio"/> Dry <input type="radio"/> Moderate <input type="radio"/> Wet
Plugs Removed? <input checked="" type="radio"/> Y <input type="radio"/> N	Recorder: SAM	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

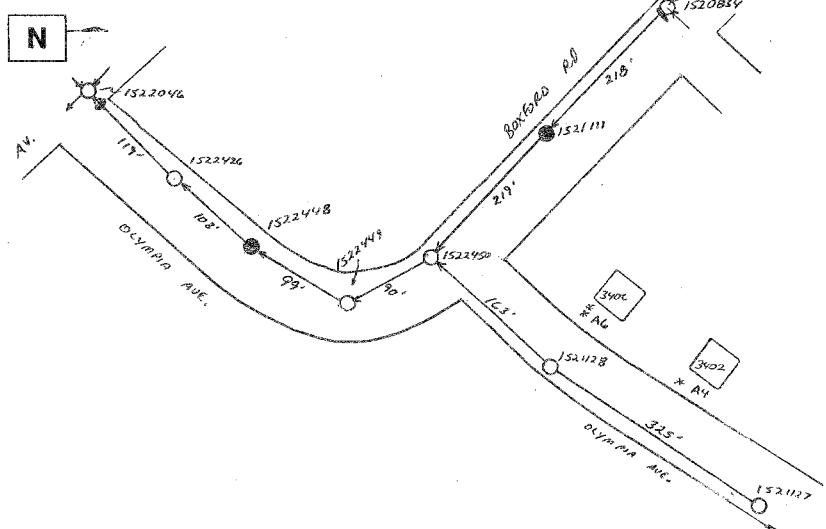

CREW COMMENTS

Last Revised 9/16/2004Leader Form

Sketch No: 346

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\346.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	346	Date:	10/25/2004	MeterBasin:	01_WR29
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	14	Setup No:	6	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
3413		Olympia	AVE

Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	3=Moderate
Sector:	2=Private	Drainage Area:	0		

Comments:

SMOKE TEST PHOTOS

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 25
Setup No. 6
346

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-25-04	Start Time: 1635
Crew: T3	Street Location: BOXFORD RD + OLYMPIA AVE		
US MH: 1520834	DS MH: 1522046	Number of Segments: 8	Test Length: 1341
Plugged US: <input checked="" type="checkbox"/> Y <input type="checkbox"/> N	Plugged DS: <input checked="" type="checkbox"/> Y <input type="checkbox"/> N	# of Blowers: 1 (2) 3	Ground: <input checked="" type="checkbox"/> Dry <input type="checkbox"/> Moderate <input type="checkbox"/> Wet
Plugs Removed? <input checked="" type="checkbox"/> Y <input type="checkbox"/> N	Recorder: SAM	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

Last Revised 9/16/2004Leader Form

Sketch No: 346

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\346.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	346	Date:	10/25/2004	MeterBasin:	01_WR29
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	2	Setup No:	6	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
3400		Olympia	AVE

Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	2=Trace
Sector:	2=Private	Drainage Area:	0		

Comments:

SMOKE TEST PHOTOS

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.




SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland


FIELD SKETCH

Page 1 of 2
Smoke Set No. 25
Setup No. 6
346

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-25-04	Start Time: 1635
Crew: T3	Street Location: BOXFORD RD + OLYMPIA AVE		
US MH: 1520834	DS MH: 1522046	Number of Segments: 8	Test Length: 1341
Plugged US: <input checked="" type="checkbox"/> Y <input type="checkbox"/> N	Plugged DS: <input checked="" type="checkbox"/> Y <input type="checkbox"/> N	# of Blowers: 1 (2) 3	Ground: <input checked="" type="checkbox"/> Dry <input type="checkbox"/> Moderate <input type="checkbox"/> Wet
Plugs Removed? <input checked="" type="checkbox"/> Y <input type="checkbox"/> N	Recorder: SAM	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

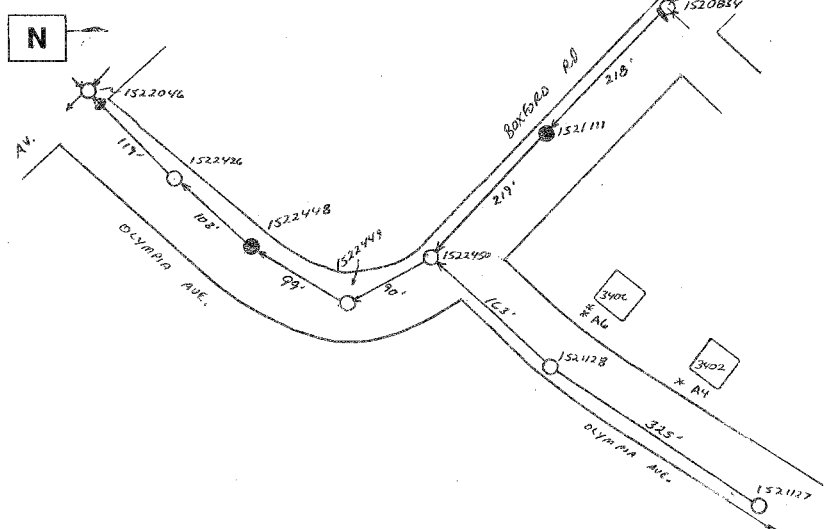

CREW COMMENTS

Last Revised 9/16/2004Leader Form

Sketch No:

346

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\346.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	346	Date:	10/25/2004	MeterBasin:	01_WR29
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	3	Setup No:	6	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
3401		Olympia	AVE

Source Type:	18= Other	Location:	14=Other	Severity:	1=No Smoke
Sector:	2=Private	Drainage Area:	0		

Comments:

SMOKE TEST PHOTOS

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.




SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland


FIELD SKETCH

Page 1 of 2
Smoke Set No. 25
Setup No. 6
346

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-25-04	Start Time: 1635
Crew: T3	Street Location: BOXFORD RD + OLYMPIA AVE		
US MH: 1520834	DS MH: 1522046	Number of Segments: 8	Test Length: 1341
Plugged US: <input checked="" type="checkbox"/> Y <input type="checkbox"/> N	Plugged DS: <input checked="" type="checkbox"/> Y <input type="checkbox"/> N	# of Blowers: 1 (2) 3	Ground: <input checked="" type="checkbox"/> Dry <input type="checkbox"/> Moderate <input type="checkbox"/> Wet
Plugs Removed? <input checked="" type="checkbox"/> Y <input type="checkbox"/> N	Recorder: SAM	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

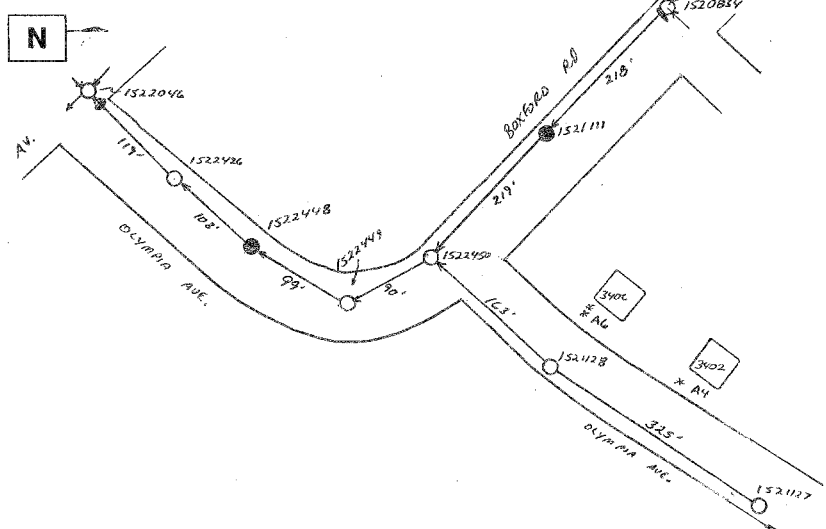

CREW COMMENTS

Last Revised 9/16/2004Leader Form

Sketch No:

346

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\346.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	346	Date:	10/25/2004	MeterBasin:	01_WR29
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	4	Setup No:	6	Priority CCTV:	

House Number	3402	Street Prefix:		Street Name:	Olympia	Street Type:	AVE
Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	3=Moderate		
Sector:	2=Private	Drainage Area:	10				
Comments:							

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 613

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1025-2004\T-3\PLAYER_A\A_2004_1025Image0613.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.




SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland


FIELD SKETCH

Page 1 of 2
Smoke Set No. 25
Setup No. 6
346

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-25-04	Start Time: 1635
Crew: T3	Street Location: BOXFORD RD + OLYMPIA AVE		
US MH: 1520834	DS MH: 1522046	Number of Segments: 8	Test Length: 1341
Plugged US: <input checked="" type="radio"/> Y <input type="radio"/> N	Plugged DS: <input checked="" type="radio"/> Y <input type="radio"/> N	# of Blowers: 1 (2) 3	Ground: <input checked="" type="radio"/> Dry <input type="radio"/> Moderate <input type="radio"/> Wet
Plugs Removed? <input checked="" type="radio"/> Y <input type="radio"/> N	Recorder: SAM	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

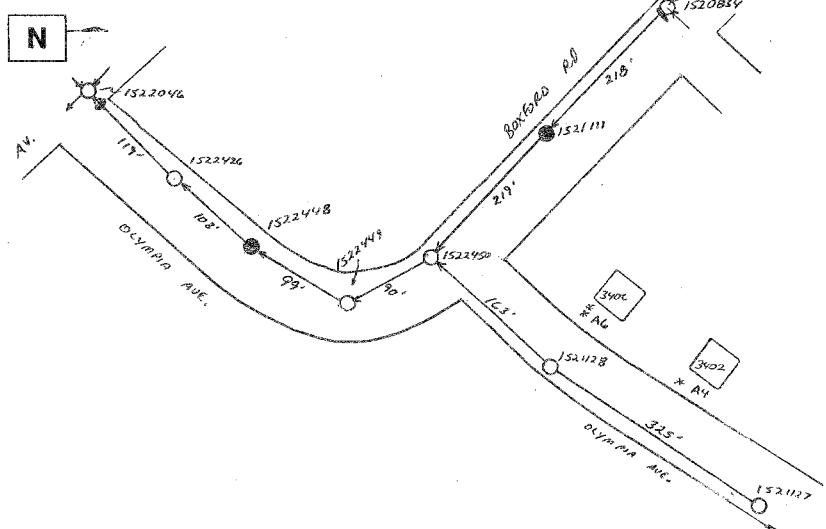

CREW COMMENTS

Last Revised 9/16/2004Leader Form

Sketch No:

346

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\346.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	346	Date:	10/25/2004	MeterBasin:	01_WR29
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	5	Setup No:	6	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
3404		Olympia	AVE

Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	3=Moderate
Sector:	2=Private	Drainage Area:	0		

Comments:

SMOKE TEST PHOTOS

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.




SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland


FIELD SKETCH

Page 1 of 2
Smoke Set No. 25
Setup No. 6
346

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-25-04	Start Time: 1635
Crew: T3	Street Location: BOXFORD RD + OLYMPIA AVE		
US MH: 1520834	DS MH: 1522046	Number of Segments: 8	Test Length: 1341
Plugged US: <input checked="" type="radio"/> Y <input type="radio"/> N	Plugged DS: <input checked="" type="radio"/> Y <input type="radio"/> N	# of Blowers: 1 (2) 3	Ground: <input checked="" type="radio"/> Dry <input type="radio"/> Moderate <input type="radio"/> Wet
Plugs Removed? <input checked="" type="radio"/> Y <input type="radio"/> N	Recorder: SAM	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

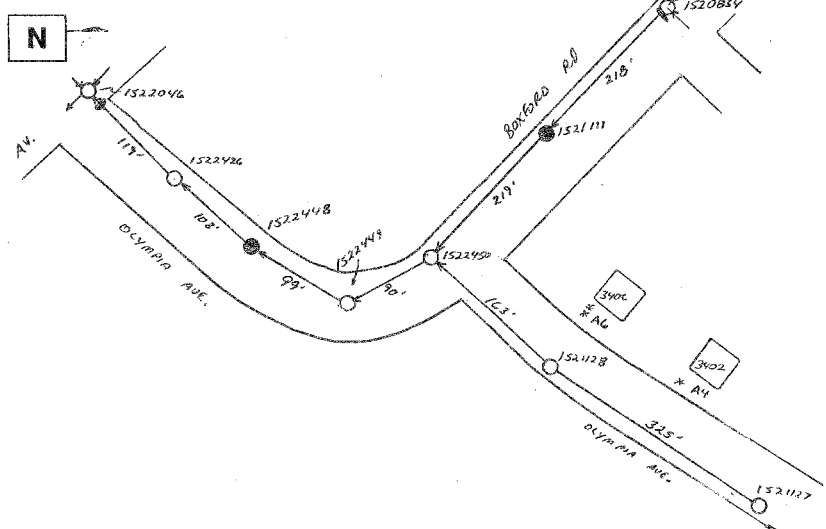

CREW COMMENTS

Last Revised 9/16/2004Leader Form

Sketch No: 346

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\346.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	346	Date:	10/25/2004	MeterBasin:	01_WR29
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	6	Setup No:	6	Priority CCTV:	

House Number	3406	Street Prefix:		Street Name:	Olympia	Street Type:	AVE
Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	2=Trace		
Sector:	2=Private	Drainage Area:	100				
Comments:							

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 614

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1025-2004\T-3\PLAYER_A\A_2004_1025Image0614.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.




SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland


FIELD SKETCH

Page 1 of 2
Smoke Set No. 25
Setup No. 6
346

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-25-04	Start Time: 1635
Crew: T3	Street Location: BOXFORD RD + OLYMPIA AVE		
US MH: 1520834	DS MH: 1522046	Number of Segments: 8	Test Length: 1341
Plugged US: <input checked="" type="checkbox"/> Y <input type="checkbox"/> N	Plugged DS: <input checked="" type="checkbox"/> Y <input type="checkbox"/> N	# of Blowers: 1 (2) 3	Ground: <input checked="" type="checkbox"/> Dry <input type="checkbox"/> Moderate <input type="checkbox"/> Wet
Plugs Removed? <input checked="" type="checkbox"/> Y <input type="checkbox"/> N	Recorder: SAM	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

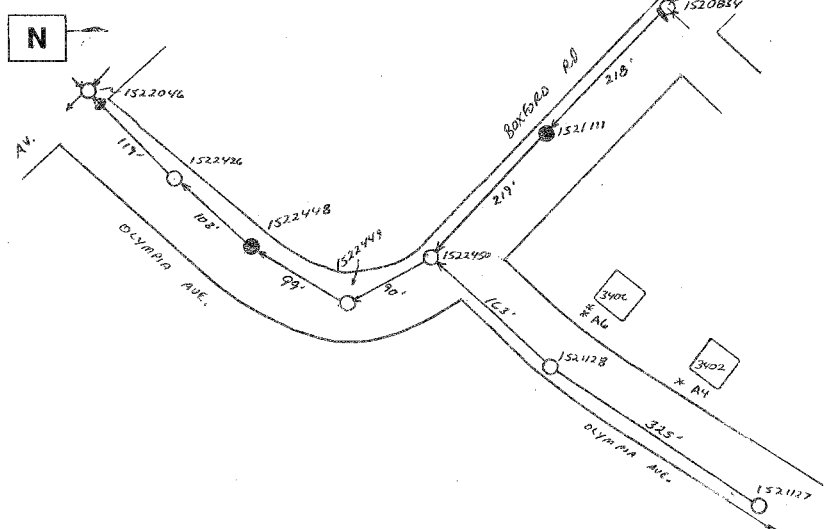

CREW COMMENTS

Last Revised 9/16/2004Leader Form

Sketch No: 346

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\346.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	346	Date:	10/25/2004	MeterBasin:	01_WR29
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	7	Setup No:	6	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
3409		Olympia	AVE

Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	4=Major
Sector:	2=Private	Drainage Area:	0		

Comments:

SMOKE TEST PHOTOS

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.




SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland


FIELD SKETCH

Page 1 of 2
Smoke Set No. 25
Setup No. 6
346

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-25-04	Start Time: 1635
Crew: T3	Street Location: BOXFORD RD + OLYMPIA AVE		
US MH: 1520834	DS MH: 1522046	Number of Segments: 8	Test Length: 1341
Plugged US: <input checked="" type="radio"/> Y <input type="radio"/> N	Plugged DS: <input checked="" type="radio"/> Y <input type="radio"/> N	# of Blowers: 1 (2) 3	Ground: <input checked="" type="radio"/> Dry <input type="radio"/> Moderate <input type="radio"/> Wet
Plugs Removed? <input checked="" type="radio"/> Y <input type="radio"/> N	Recorder: SAM	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

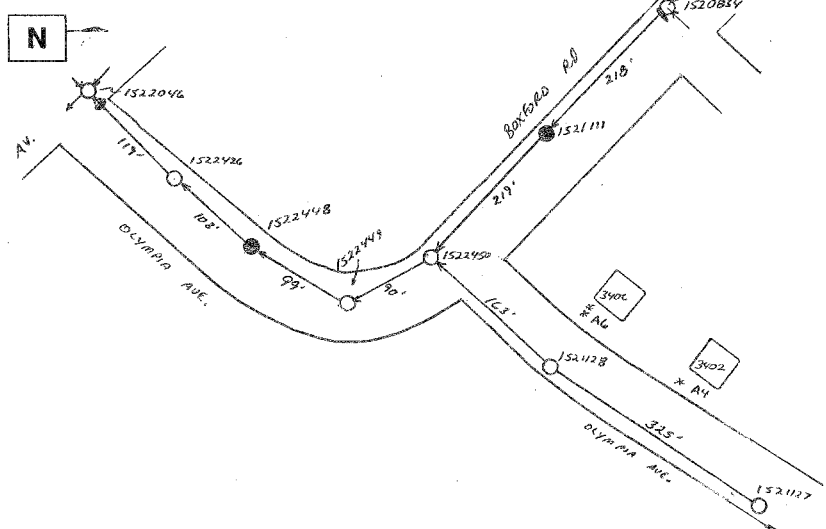

CREW COMMENTS

Last Revised 9/16/2004Leader Form

Sketch No: 346

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\346.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	346	Date:	10/25/2004	MeterBasin:	01_WR29
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	8	Setup No:	6	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
3408		Olympia	AVE

Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	3=Moderate
Sector:	2=Private	Drainage Area:	0		

Comments:

SMOKE TEST PHOTOS

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.




SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland


FIELD SKETCH

Page 1 of 2
Smoke Set No. 25
Setup No. 6
346

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-25-04	Start Time: 1635
Crew: T3	Street Location: BOXFORD RD + OLYMPIA AVE		
US MH: 1520834	DS MH: 1522046	Number of Segments: 8	Test Length: 1341
Plugged US: <input checked="" type="checkbox"/> Y <input type="checkbox"/> N	Plugged DS: <input checked="" type="checkbox"/> Y <input type="checkbox"/> N	# of Blowers: 1 (2) 3	Ground: <input checked="" type="checkbox"/> Dry <input type="checkbox"/> Moderate <input type="checkbox"/> Wet
Plugs Removed? <input checked="" type="checkbox"/> Y <input type="checkbox"/> N	Recorder: SAM	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

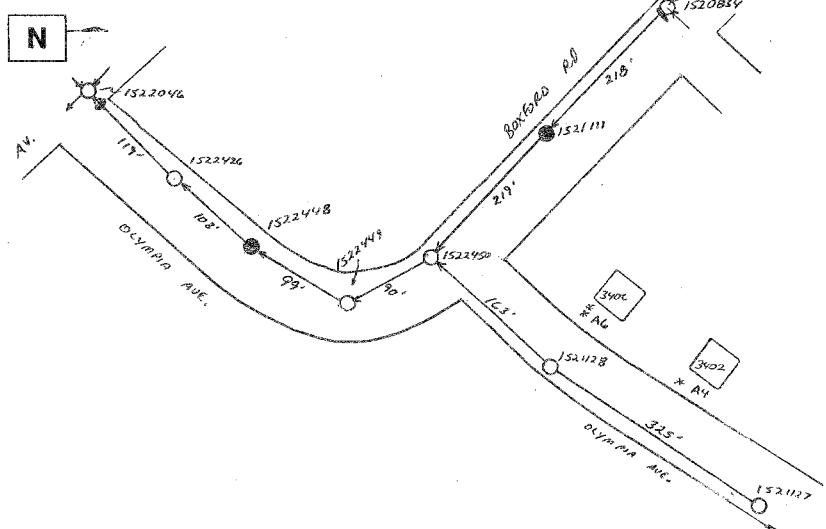

CREW COMMENTS

Last Revised 9/16/2004Leader Form

Sketch No:

346

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\346.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	346	Date:	10/25/2004	MeterBasin:	01_WR29
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	9	Setup No:	6	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
7006		Boxford	ROAD

Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	2=Trace
Sector:	2=Private	Drainage Area:	0		

Comments:

SMOKE TEST PHOTOS

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.




SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland


FIELD SKETCH

Page 1 of 2
Smoke Set No. 25
Setup No. 6
346

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-25-04	Start Time: 1635
Crew: T3	Street Location: BOXFORD RD + OLYMPIA AVE		
US MH: 1520834	DS MH: 1522046	Number of Segments: 8	Test Length: 1341
Plugged US: <input checked="" type="radio"/> Y <input type="radio"/> N	Plugged DS: <input checked="" type="radio"/> Y <input type="radio"/> N	# of Blowers: 1 (2) 3	Ground: <input checked="" type="radio"/> Dry <input type="radio"/> Moderate <input type="radio"/> Wet
Plugs Removed? <input checked="" type="radio"/> Y <input type="radio"/> N	Recorder: SAM	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

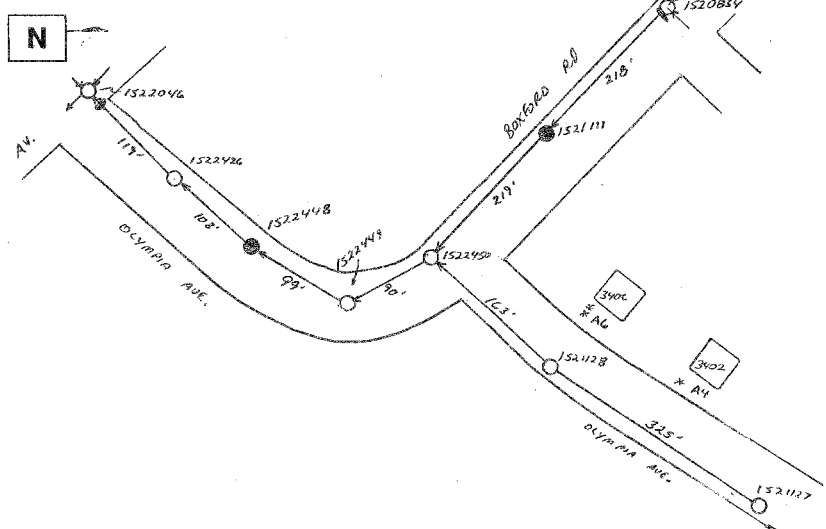

CREW COMMENTS

Last Revised 9/16/2004Leader Form

Sketch No:

346

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\346.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	347	Date:	10/26/2004	MeterBasin:	01_WR19
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	1	Setup No:	1	Priority CCTV:	

House Number	5924	Street Prefix:		Street Name:	Cross Country	Street Type:	Blvd
Source Type:	18= Other	Location:	7=Yard-Front	Severity:	2=Trace		
Sector:	1=Public	Drainage Area:	16				
Comments:							

SMOKE TEST PHOTOS



Photo No:
Filename Path:

Image Status: No image name specified.

Photo No: 897

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1026-2004\T-2\PLAYER_B\B_2004_1026Image0897.JPG

Image Status: Image found and displayed.

Photo No:
Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 29
Setup No. 1
347 (29)

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/26/04	Start Time: 0855
Crew: T2	Street Location: Cross Country Blvd		
US MH: 1520875	DS MH: 1520997	Number of Segments: 8	Test Length: 1883'
Plugged US: Y (N)	Plugged DS: Y (N)	# of Blowers: 1 (2) 3	Ground: Dry Moderate Wet
Plugs Removed? Y (N)	Recorder: Bob Blank	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

Last Revised 9/16/2004

Leader Form

Sketch No: 347

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\347.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	347	Date:	10/26/2004	MeterBasin:	01_WR19
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	2	Setup No:	1	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
5922		Cross Country	Blvd

Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	3=Moderate
Sector:	2=Private	Drainage Area:	0		

Comments:

SMOKE TEST PHOTOS

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 29
Setup No. 1
347 (29)

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/26/04	Start Time: 0855
Crew: T2	Street Location: Cross Country Blvd		
US MH: 1520875	DS MH: 1520997	Number of Segments: 8	Test Length: 1883'
Plugged US: Y (N)	Plugged DS: Y (N)	# of Blowers: 1 (2) 3	Ground: Dry Moderate Wet
Plugs Removed? Y (N)	Recorder: Bob Blank	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

Last Revised 9/16/2004
Leader Form

Sketch No: 347

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\347.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	347	Date:	10/26/2004	MeterBasin:	
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	3	Setup No:	1	Priority CCTV:	
House Number	5920	Street Prefix:		Street Name:	
				Cross Country	
				Blvd	
Source Type:	12= MH Frame Seal	Location:	7=Yard-Front	Severity:	4=Major
Sector:	1=Public	Drainage Area:	9		
Comments:	MH 1522440				

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 898

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1026-2004\T-2\PLAYER_B\B_2004_1026Image0898.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.

SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM

Page 1 of 2
Smoke Set No. 29
Setup No. 1

347 (29)

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/26/04	Start Time: 0855
Crew: T2	Street Location: Cross Country Blvd		
US MH: 1520875	DS MH: 1520997	Number of Segments: 8	Test Length: 1883'
Plugged US: Y (N)	Plugged DS: Y (N)	# of Blowers: 1 (2) 3	Ground: (Dry) Moderate Wet
Plugs Removed? Y (N)	Recorder: Bob Blenk	Comments:	
FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)			

CREW COMMENTS

82?

Last Revised 9/16/2004

Leader Form

Sketch No: 347

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\347.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	347	Date:	10/26/2004	MeterBasin:	
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	4	Setup No:	1	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:		
5920		Cross Country	Blvd		
Source Type:	02= Service Line	Location:	7=Yard-Front	Severity:	2=Trace
Sector:	1=Public	Drainage Area:	4		
Comments:					

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 899

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1026-2004\T-2\PLAYER_B\B_2004_1026Image0899.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 29
Setup No. 1
347 (29)

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/26/04	Start Time: 0855
Crew: T2	Street Location: Cross Country Blvd		
US MH: 1520875	DS MH: 1520997	Number of Segments: 8	Test Length: 1883'
Plugged US: Y (N)	Plugged DS: Y (N)	# of Blowers: 1 (2) 3	Ground: Dry Moderate Wet
Plugs Removed? Y (N)	Recorder: Bob Blank	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

827

Last Revised 9/16/2004

Leader Form

Sketch No: 347

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\347.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	347	Date:	10/26/2004	MeterBasin:	
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	5	Setup No:	1	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
5920		Cross Country	Blvd

Source Type:	02= Service Line	Location:	7=Yard-Front	Severity:	3=Moderate
Sector:	1=Public	Drainage Area:	16		

Comments:

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 900

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1026-2004\T-2\PLAYER_B\B_2004_1026Image0900.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 29
Setup No. 1
347 (29)

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/26/04	Start Time: 0855
Crew: T2	Street Location: Cross Country Blvd		
US MH: 1520875	DS MH: 1520997	Number of Segments: 8	Test Length: 1883'
Plugged US: Y (N)	Plugged DS: Y (N)	# of Blowers: 1 (2) 3	Ground: Dry Moderate Wet
Plugs Removed? Y (N)	Recorder: Bob Blank	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS: 82?

Last Revised 9/16/2004
Leader Form

Sketch No: 347

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\347.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	347	Date:	10/26/2004	MeterBasin:	01_WR19
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	Y
Defect No:	6	Setup No:	1	Priority CCTV:	

House Number	5914	Street Prefix:		Street Name:	Cross Country	Street Type:	Blvd
Source Type:	14= Catch Basin	Location:	6=Curb	Severity:	4=Major		
Sector:	1=Public	Drainage Area:	5000				
Comments:							

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 901

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1026-2004\T-2\PLAYER_B\B_2004_1026Image0901.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.

SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 29
Setup No. 1

BUREAU OF WATER AND WASTEWATER SMOKE TEST INSPECTION FORM

347 (29)

TEST LOCATION				
Project: WRPA	Sewershed: Jones Falls	Date: 10/26/04	Start Time: 0855	
Crew: T2	Street Location: Cross Country Blvd			
US MH: 1520875	DS MH: 1520997	Number of Segments: 8	Test Length: 1883'	
Plugged US: Y <u>N</u>	Plugged DS: Y <u>N</u>	# of Blowers: 1 <u>2</u> 3	Ground: <u>Dry</u> Moderate Wet	
Plugs Removed? Y <u>N</u>	Recorder: Bob Blank	Comments:		

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

The field sketch shows a plan view of the sewer test area. A north arrow points towards the top left. The main sewer line runs from the bottom left towards the top right, following the path of Cross Country Blvd. Several manholes are identified by circles and labeled with IDs: 1520875, 1521300, 1521150, 1521297, 1521449, 1521301, 1521302, 1521440, and 1520997. Distances between manholes are noted along the line: 200', 317', 268', 203', 249', 335', and 80'. Other features include a creek running parallel to the sewer line on the right side, several buildings represented by rectangles with labels like 'B1', 'B2', 'B3', 'B4', 'B5', 'B6', 'B7', and 'B8', and various measurements such as 8'4", 8'5", 231', and 200'. A note near the top right says 'could not open' with an arrow pointing to a specific location.

CREW COMMENTS

(B2?)

Last Revised 9/16/2004

Leader Form

Sketch No: 347

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\347.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	347	Date:	10/26/2004	MeterBasin:	
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	7	Setup No:	1	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
5914		Cross Country	Blvd

Source Type:	18= Other	Location:	7=Yard-Front	Severity:	4=Major
Sector:	1=Public	Drainage Area:	9		

Comments:

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 902

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1026-2004\T-2\PLAYER_B\B_2004_1026Image0902.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.

SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM

Page 1 of 2
Smoke Set No. 29
Setup No. 1

347 (2)

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/26/04	Start Time: 0855
Crew: T2	Street Location: Cross Country Blvd		
US MH: 1520875	DS MH: 1520997	Number of Segments: 8	Test Length: 1883'
Plugged US: Y (N)	Plugged DS: Y (N)	# of Blowers: 1 (2) 3	Ground: (Dry) Moderate Wet
Plugs Removed? Y (N)	Recorder: Bob Blank	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

Sketch No: 347

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\347.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	347	Date:	10/26/2004	MeterBasin:	
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	8	Setup No:	1	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:		
5908		Cross Country	Blvd		
Source Type:	12= MH Frame Seal	Location:	11=Field	Severity:	4=Major
Sector:	1=Public	Drainage Area:	9		
Comments:	MH 01521300				

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 903

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1026-2004\T-2\PLAYER_B\B_2004_1026Image0903.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 29
Setup No. 1
347 (29)

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/26/04	Start Time: 0855
Crew: T2	Street Location: Cross Country Blvd		
US MH: 1520875	DS MH: 1520997	Number of Segments: 8	Test Length: 1883'
Plugged US: Y (N)	Plugged DS: Y (N)	# of Blowers: 1 (2) 3	Ground: Dry Moderate Wet
Plugs Removed? Y (N)	Recorder: Bob Blank	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

Last Revised 9/16/2004

Leader Form

Sketch No: 347

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\347.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	348	Date:	10/26/2004	MeterBasin:	
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	1	Setup No:	2	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:		
5902		Cross Country	Blvd		
Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	4=Major
Sector:	2=Private	Drainage Area:	0		
Comments:					

SMOKE TEST PHOTOS

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.




SMOKE TESTING OBSERVATION SUMMARY


Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 29
Setup No. 2
348

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/26/04	Start Time: 1215
Crew: T2	Street Location: Cross Country Blvd	Number of Segments: 7	Test Length: 1588'
US MH: 1521306	DS MH: 0691607	# of Blowers: 1 2 3	Ground: (Dry) Moderate Wet
Plugged US: Y (N)	Plugged DS: Y (N)	Plugs Removed? Y (N) Recorder: Bob Blank Comments: —	
FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)			

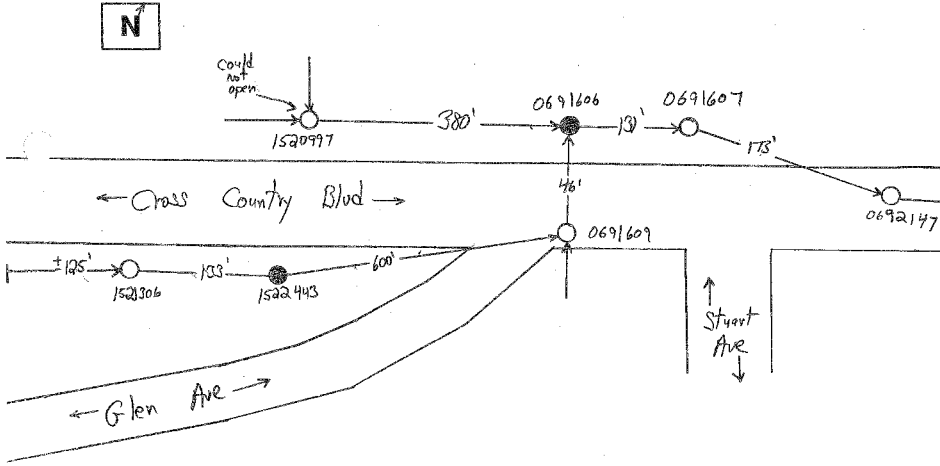

CREW COMMENTS

Last Revised 9/16/2004Leader Form

Sketch No: 348

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\348.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	348	Date:	10/26/2004	MeterBasin:	01_WR04
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	2	Setup No:	2	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:		
2700		Glen	AVE		
Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	4=Major
Sector:	2=Private	Drainage Area:	0		
Comments:					

SMOKE TEST PHOTOS

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 29
Setup No. 2
348

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/26/04	Start Time: 1215
Crew: T2	Street Location: Cross Country Blvd	Number of Segments: 7	Test Length: 1588'
US MH: 1521306	DS MH: 0691607	# of Blowers: 1 2 3	Ground: (Dry) Moderate Wet
Plugged US: Y (N)	Plugged DS: Y (N)	Recorder: Bob Blank	Comments: —
Plugs Removed? Y (N)			

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

Last Revised 9/16/2004 Leader Form

Sketch No: 348

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\348.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	349	Date:	10/26/2004	MeterBasin:	01_WR18
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	Y
Defect No:	1	Setup No:	3	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
5820		Stuart	AVE
Source Type:	14= Catch Basin	Location:	9=Yard-Side
Sector:	1=Public	Drainage Area:	4000
Severity:	3=Moderate		
Comments:			

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 904

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1026-2004\T-2\PLAYER_B\B_2004_1026Image0904.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 29
Setup No. 3
349

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/26/04	Start Time: 1320
Crew: T2	Street Location: Cross Country Rd		
US MH: 0692250	DS MH: 0692376	Number of Segments: 8	Test Length: 1828'
Plugged US: <input checked="" type="checkbox"/> N	Plugged DS: <input checked="" type="checkbox"/> N	# of Blowers: 1 2 3	Ground: <input checked="" type="checkbox"/> Dry Moderate Wet
Plugs Removed? <input checked="" type="checkbox"/> N	Recorder: Bob Blank	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

0692147 is below grade, has a storm m.h. cover (many vent holes), & is along the curb.
This is a major inflow source

CREW COMMENTS

The over flow has been concreted shut but heavy smoke still comes out of the over flow. The creek also has risen a couple of feet above the invert of the overflow.

Last Revised 9/16/2004 Leader Form

Sketch No:

349

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\349.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	349	Date:	10/26/2004	MeterBasin:	01_WR18
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	2	Setup No:	3	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
5820		Stuart	AVE

Source Type:	18= Other	Location:	11=Field	Severity:	4=Major
Sector:	1=Public	Drainage Area:	50000		

Comments: immense drainage - overflow pipe plugged, but still smokes. SSO structure was field verified to be plugged. CCTV inspection and manhole inspection will be reviewed to assess potential sources of smoke.

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 905

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1026-2004\T-2\PLAYER_B\B_2004_1026Image0905.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 29
Setup No. 3
349

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/26/04	Start Time: 1320
Crew: T2	Street Location: Cross Country Rd		
US MH: 0692250	DS MH: 0692376	Number of Segments: 8	Test Length: 1828'
Plugged US: <input checked="" type="checkbox"/> N	Plugged DS: <input checked="" type="checkbox"/> N	# of Blowers: 1 2 3	Ground: <input checked="" type="checkbox"/> Dry Moderate Wet
Plugs Removed? <input checked="" type="checkbox"/> N	Recorder: Bob Blank	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

0692147 is below grade, has a storm m.h. cover (many vent holes), & is along the curb.
This is a major inflow source

CREW COMMENTS

The over flow has been concreted shut but heavy smoke still comes out of the over flow. The creek also has risen a couple of feet above the invert of the overflow.

Last Revised 9/16/2004
Leader Form

Sketch No:

349

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\349.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.